## 7. 上糸の通し方 / THREADING THE MACHINE HEAD / 上線的穿線方法




不意の起動による人身の損傷を防ぐために電源を切り、モータの回転が止まったことを確認してから 行ってください。

WARNING:

To protect against possible personal injury due to abrupt start of the machine, be sure to start the following work after turning the power off and ascertaining that the motor is at rest.



為了防止突然啟動造成人身事故,請關掉電源,確認馬達確實停止轉動後再進行。

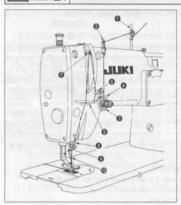


如圖所示的●~●順序進行穿線。

把穿過針孔的線頭留出 10cm 左右。

(注意)使用以上的粗線時以及尼龍、滌綸線時,把線從導線桿❶的線張力盤之間穿過去之後,再把線穿過第 3個線架❷。

## 8. 下糸の通し方 / THREADING THE BOBBIN THREAD / 底線的穿線方法



上糸は図のように●~●の順に通します。 針穴に通した糸は 10cm 程引き出しておきます。

(注意) 綿糸#50以上の太い糸を使用する場合及びナイロン、テトロン糸をご使用になる場合は、糸 案内棒●の糸裏子皿の間に糸を通してから三 つ目糸掛け●に糸を通してください。

Pass the needle thread in the order of **1** through **1** as illustrated in the figure.

Pull out the thread approximately 10 cm from the needle after passing it through the needle eyelet.

(Note)

When cotton thread #50 or thicker is used, or nylon thread or tetoron thread is used, pass the thread through three hole thread eyelet ❷ after passing the thread between the tension disks of thread guide pin ❸.

下糸はボビンケースに入れ、糸調子ばねの下を通し、 糸をボビンケース正面の糸穴●を通してから釜に装着 してください。

Place the bobbin into the bobbin case, pass the bobbin thread under the tension spring of bobbin case, and pass it through thread eyelet 
in the front face of bobbin case. Then, insert the bobbin case to the hook.

把底線放入核殼,從線張力彈簧的下面穿過,線從核殼 正面的線孔**①**穿過之後放入旋梭裡。