



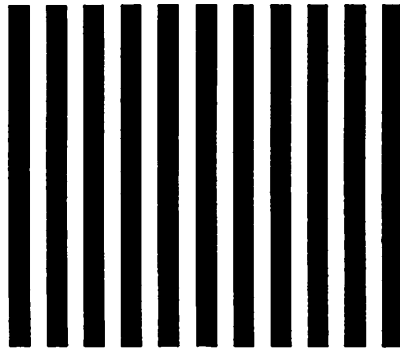


PARTS LIST

TME-DC

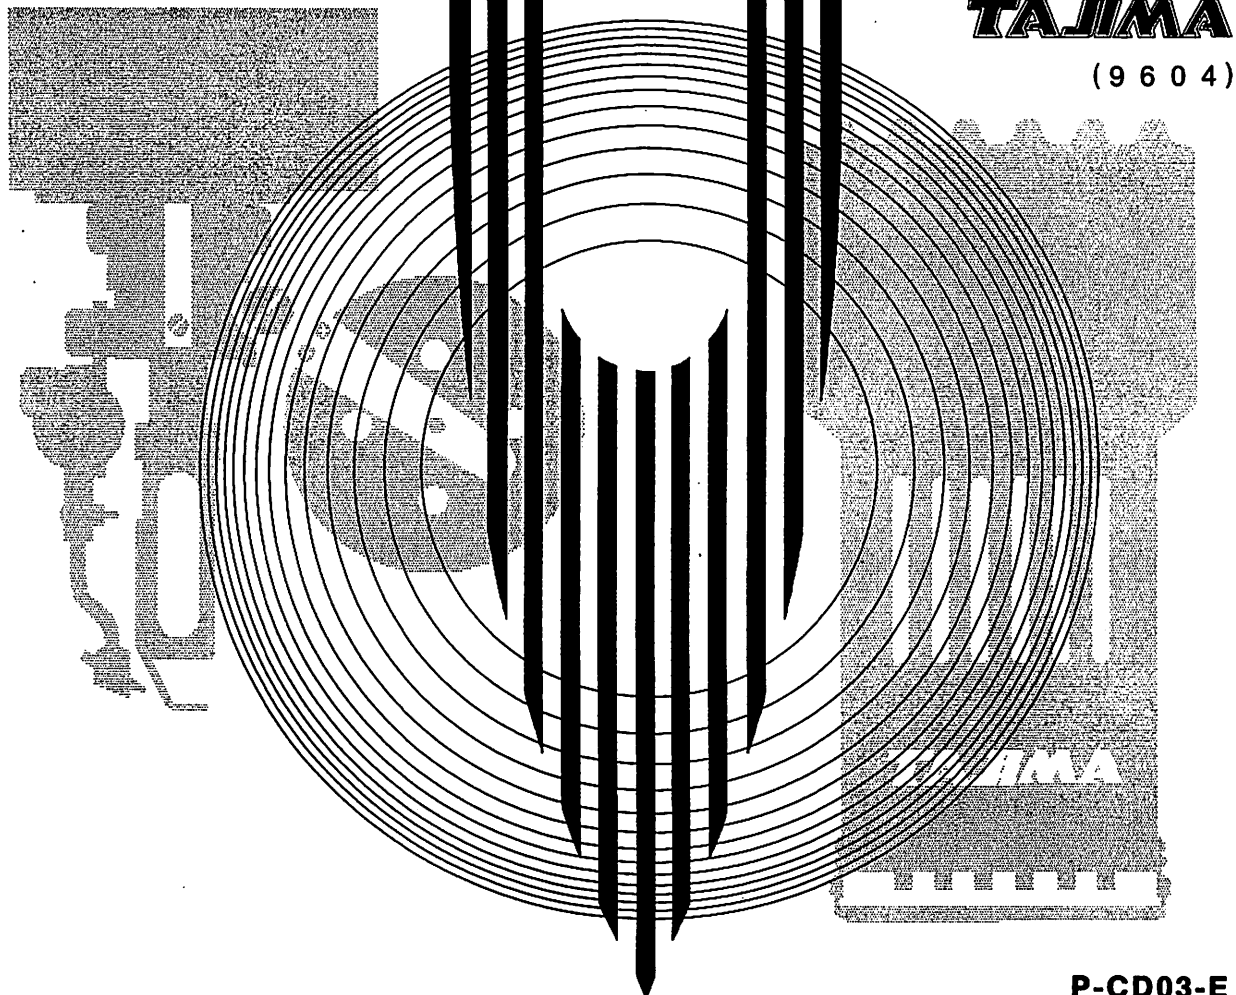

P-CD03-E

From the library of: Superior Sewing Machine & Supply LLC

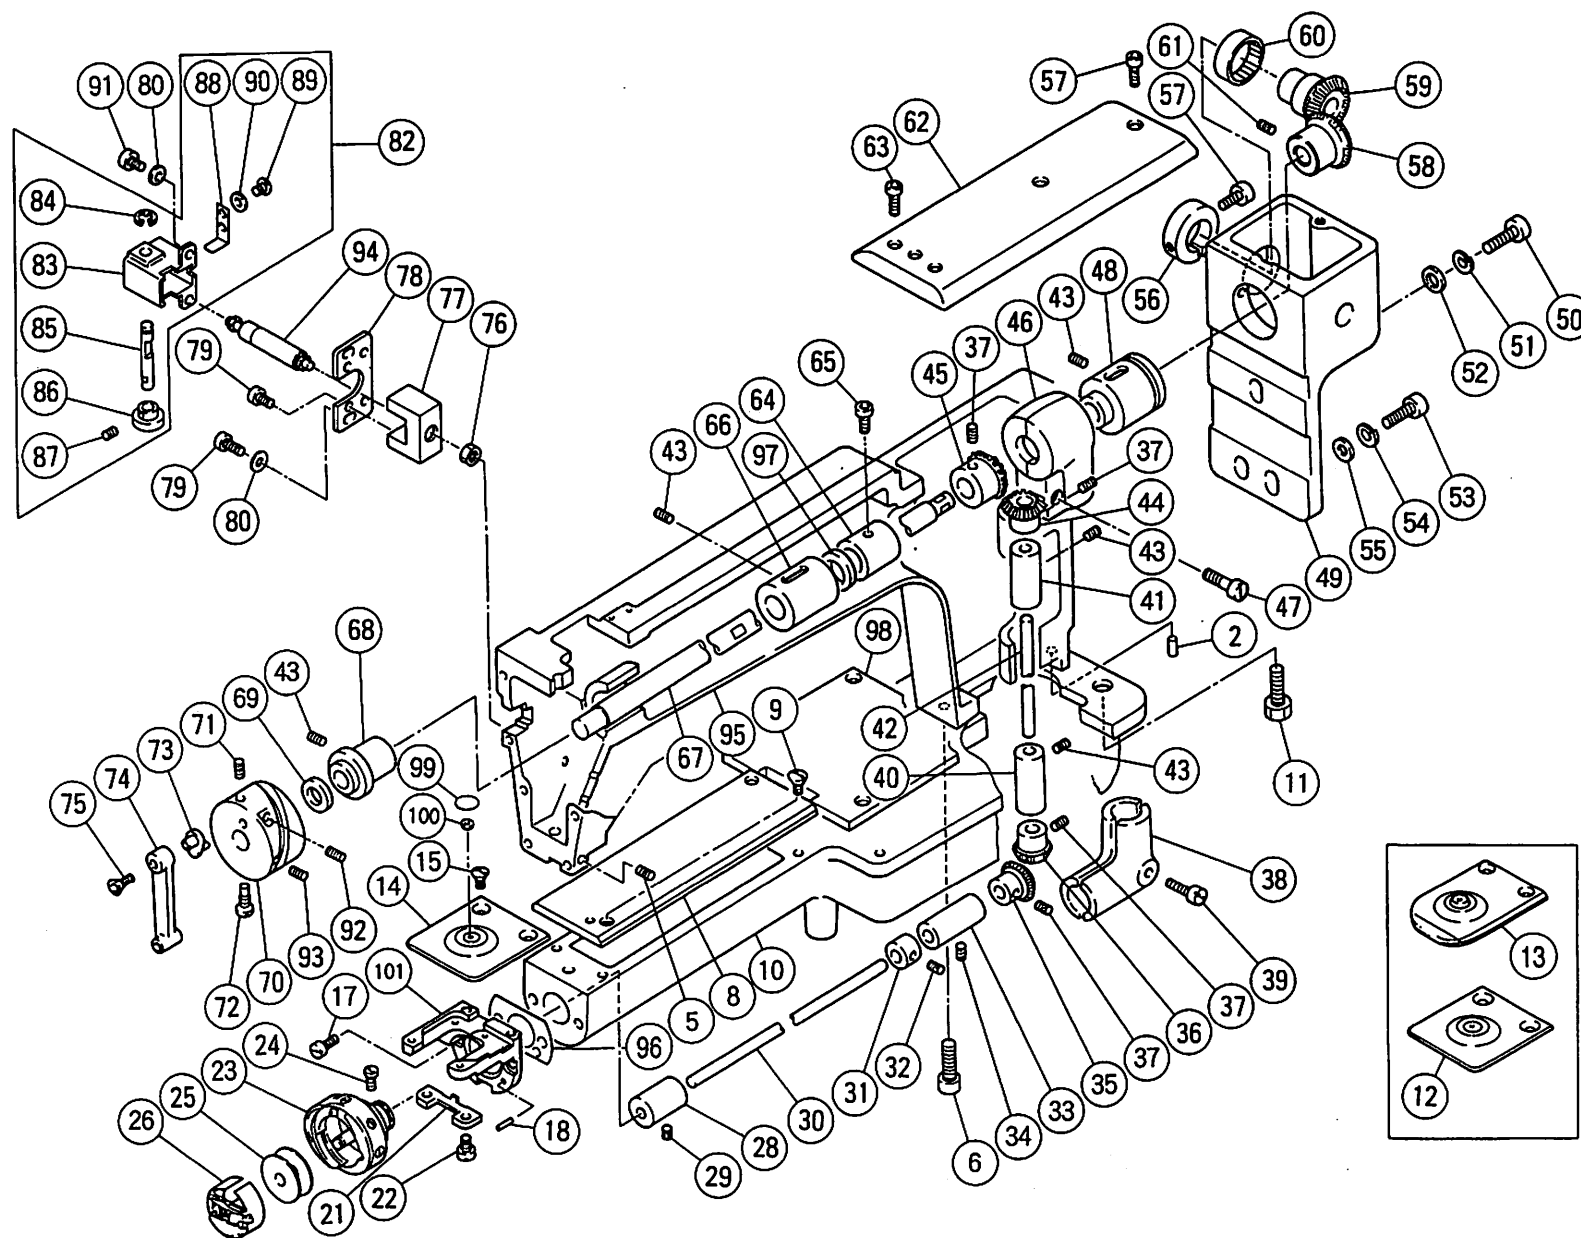

TME-DC ARM I

CD-5-1

Ref No.	Description	Part No.	Remark	Ref No.	Description	Part No.	Remark
2	Taper Pin		6P * 25L	39	Flat Fillister Head Screw	SM 6 0 1 8 2 4 C C 0 0	9/32 * 28 * 24L
5	Hollow Set Screw	SS 8 2 0 5 1 0 0 T N 0	M5 * 10L	40	Vertical Shaft Bushing, Lower	ME 0 5 1 5 0 0 0 0 0 0	
6	Hexagon Socket Head Cap Screw	SS 6 2 1 2 3 0 0 T N 0	M12 * 30L	41	Vertical Shaft Bushing, Upper	ME 0 5 1 6 0 0 0 0 0 0	
8	Bed Cover C	CM 0 5 0 3 0 0 0 0 0 0		42	Vertical Shaft	ME 0 5 1 8 0 0 0 0 0 0	
9	Round Head Screw	SM 3 0 1 1 0 7 S A 0 0	11/64 * 40 * 7L	43	Set Screw	SM 8 0 1 5 1 7 T N 0 0	15/64 * 28 * 17L
10	Arm Bed	CM 0 5 0 1 0 0 0 0 0 0		44	Vertical Shaft Bevel Gear, Upper	ME 0 5 1 7 0 0 0 0 0 0	
11	Hexagon Bolt	SS 9 3 1 0 3 0 0 C Z 0	M10 * 30L	45	Arm Shaft Bevel Gear A	ME 0 5 2 6 0 0 0 0 0 0	
12	Needle Plate (Tubular Goods)	CM 0 5 0 4 0 0 0 0 0 0		46	Gear Case B	ME 0 5 5 9 0 0 0 0 0 0	
13	Needle Plate (Cap Embroidery)	CM 0 5 0 5 0 3 0 0 0 0		47	Flat Fillister Head Screw	SM 6 0 0 9 1 2 C C 0 0	9/64 * 40 * 12L
14	Needle Plate (Standard Embroidery)	CM 0 5 0 6 0 0 0 0 0 0		48	Arm Shaft Bushing, Rear	ME 0 5 2 1 0 0 0 0 0 0	
15	Round Countersunk Head Screw	EG 0 2 2 8 0 0 0 0 0 0	11/64 * 40 * 8L	49	Main Shaft Gear Box	ME 0 5 4 9 0 0 0 0 0 0	
17	Flat Fillister Head Screw	SM 6 0 1 1 1 5 C C 0 0	11/64 * 40 * 15L	50	Hexagon Socket Head Cap Screw	SS 6 2 0 8 3 0 0 T N 0	M8 * 30L
18	Taper Pin		3P * 12L	51	Spring Washer		M8
21	Rotary Hook Support	CM 0 5 0 8 0 0 * * * *		52	Plain Washer		M8
22	Rotary Hook Support Set Screw	SM 6 0 0 9 0 6 C C 0 0	9/64 * 40 * 6L	53	Hexagon Socket Head Cap Screw	SS 6 2 0 6 3 0 0 T N 0	M6 * 30L
23	Rotary Hook	ME 0 5 0 5 0 3 * * * *		54	Spring Washer		M6
24	Rotary Hook Set Screw		11/64 * 40 * 4.3L	55	Plain Washer		M6
25	Bobbin	ME 0 5 0 4 0 2 * * * *		56	Gear Stopper Split Collar	ME 0 5 5 2 0 0 0 0 0 0	
26	Bobbin Case	ME 0 5 0 3 0 0 * * * *		57	Hexagon Socket Head Cap Screw	SS 6 2 0 5 1 5 0 T N 0	M5 * 15L
28	Oscillating Shaft Bushing, Front	CM 0 5 1 2 0 0 0 0 0 0		58	Arm Shaft Bevel Gear B	ME 0 5 5 0 0 0 0 0 0 0	
29	Set Screw	SM 8 0 1 5 0 5 T N 0 0	15/64 * 28 * 5L	59	Arm Shaft Drive Bevel Gear	ME 0 5 5 1 0 0 0 0 0 0	
30	Oscillating Shaft	ME 0 5 0 9 0 0 0 0 0 0		60	Needle Bearing	B P H K 2 5 1 2 0 0 0 0	
31	Oscillating Shaft Collar	ME 0 5 1 0 0 0 0 0 0 0		61	Hollow Set Screw	SS 8 2 0 6 0 6 0 T N 0	M6 * 6L
32	Hollow Set Screw	SM 8 2 1 6 0 5 T N 0 0	1/4 * 40 * 5L	62	Arm Top Cover	ME 0 5 5 3 0 0 0 0 0 0	
33	Oscillating Shaft Bushing, Rear	ME 0 5 1 1 0 0 0 0 0 0		63	Hexagon Socket Head Cap Screw	SS 6 2 0 5 2 0 0 T N 0	M5 * 20L
34	Hollow Set Screw	SM 8 2 1 5 1 0 T N 0 0	15/64 * 28 * 10L	64	Arm Shaft Collar	ME 0 5 1 9 0 0 0 0 0 0	
35	Oscillating Shaft Bevel Gear	ME 0 5 1 2 0 0 0 0 0 0		65	Hexagon Socket Head Cap Screw	SS 6 2 0 6 0 9 0 T N 0	M6 * 9L
36	Vertical Shaft Bevel Gear, Lower	ME 0 5 1 4 0 0 0 0 0 0		66	Arm Shaft Bushing, Middle	ME 0 5 2 2 0 0 0 0 0 0	
37	Hollow Set Screw	SM 8 2 1 6 0 6 T N 0 0	1/4 * 40 * 6L	67	Arm Shaft	ME 0 5 2 0 0 0 0 0 0 0	
38	Gear Case A	ME 0 5 1 3 0 0 0 0 0 0		68	Arm Shaft Bushing, Front	ME 0 5 2 3 0 0 0 0 0 0	

Note: As for parts with marks # or *, please follow our instructions on Tube of contents, in your parts order.

(9604)

From the library of: Superior Sewing Machine & Supply LLC

TME-DC ARM I


CD-5-1

Ref No.	Description	Part No.	Remark	Ref No.	Description	Part No.	Remark
69	Quenched Spacer	ME 0 5 2 5 0 0 0 0 0 0		100	Needle Plate Hole Collar	E F 0 2 0 2 2 0 0 0 0 0	
70	Take-up Lever Drive Cam	ME 0 5 2 4 0 0 0 0 0 0		101	Needle Plate Bracket	CM 0 5 0 7 0 1 0 0 0 0	
71	Set Screw	SM 8 0 1 6 0 5 TN 0 0	1/4 * 40 * 5L				
72	Cam Set Screw	ME 0 5 6 0 0 0 0 0 0 0					
73	90-degrees Crank	ME 0 5 3 8 0 0 0 0 0 0					
74	Connecting Rod	ME 0 5 2 8 0 1 0 0 0 0					
75	Countersunk Head Screw, Counterclockwise		9/64 * 40 * 12L				
76	Hexagon Nut	EG 0 5 4 8 0 0 0 0 0 0	M9 * P0.75				
77	Solenoid Bracket	ME 0 5 4 2 0 0 0 0 0 0					
78	Bracket Base	ME 0 5 3 9 0 0 0 0 0 0					
79	Hexagon Socket Head Cap Screw	SS 6 2 0 4 0 8 0 TN 0	M4 * 8L				
80	Plain Washer		M4				
82	Solenoid Cover Set	ME 0 5 4 3 S 1 0 0 0 0					
83	Solenoid Cover	ME 0 5 4 3 0 1 0 0 0 0					
84	E-ring	BPE 5 0 0 0 0 0 0 0 0					
85	Clutch Pin	EF 0 5 4 0 0 0 0 0 0 0					
86	Clutch Knurled Screw	EF 0 5 3 9 0 0 0 0 0 0					
87	Hollow Set Screw	SS 8 2 0 3 0 3 0 TN 0	M3 * 3L				
88	Stopper Plate Spring	ME 0 5 4 4 0 0 0 0 0 0					
89	Pan Head Screw	SS 4 1 0 3 0 4 0 SD 0	M3 * 4L				
90	Plain Washer		M3				
91	Hexagon Socket Head Cap Screw	SS 6 2 0 4 0 6 0 TN 0	M4 * 6L				
92	Set Screw	SM 8 0 1 6 0 8 TN 0 0	1/4 * 40 * 8L				
93	Set Screw	SM 8 0 1 5 1 0 TN 0 0	15/64 * 28 * 10L				
94	Jump Solenoid	EG 6 8 0 1 0 2 0 0 0 0					
95	Arm	ME 0 5 0 1 0 1 0 0 0 0					
96	Needle Plate Bracket Spacer	CM 0 5 1 4 0 0 0 0 0 0					
97	Arm Shaft Spacer	ME 0 5 6 3 0 0 0 0 0 0					
98	Bed Cover A	CM 0 5 1 5 0 0 0 0 0 0					
99	Needle Plate Hole Seal	EF 0 2 0 2 3 0 0 0 0 0					

Note: As for parts with marks # or *, please follow our instructions on Table of Contents, in your part order.

From the library of: Superior Sewing Machine & Supply LLC

(9 6 0 4)

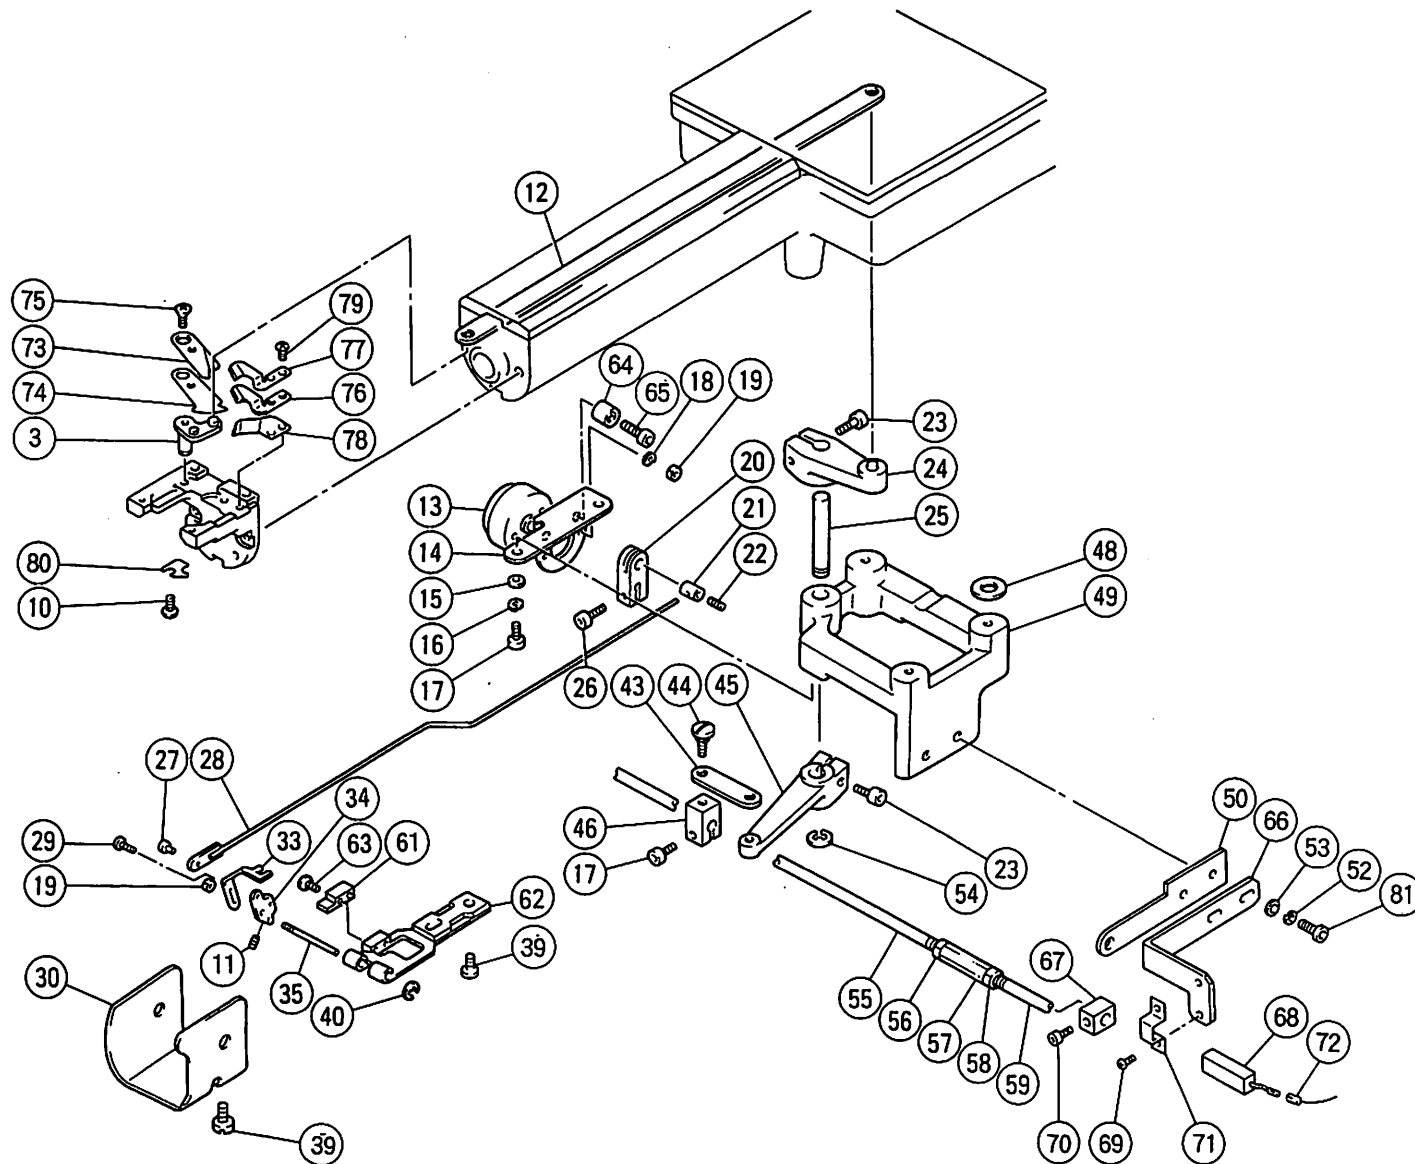

TME-DC KNIFE DRIVE SET & PICKER SET

CD-7

Ref No.	Description	Part No.	Remark	Ref No.	Description	Part No.	Remark
3	Movable Knife Drive Arm	A C 0 5 0 6 0 1 0 0 0 0		46	Connecting Stud	A T 0 2 0 8 0 0 0 0 0 0	
10	Pan Head Screw	S S 4 1 0 2 0 3 0 M Z 0	M2 * 3L	48	Positioning Collar	A C 0 3 0 2 0 0 0 0 0 0	
11	Hollow Set Screw	S S 8 2 0 3 0 5 0 T N 0	M3 * 5L	49	Arm Base	A C 0 5 0 1 0 0 0 0 0 0	
12	Connecting Plate B	A C 0 5 0 5 0 0 0 0 0 0		50	Shaft Holder	A C 0 5 0 8 0 0 0 0 0 0	
13	Picker Solenoid	A T 6 8 0 3 B 1 0 0 0 0		52	Spring Washer		M5
14	Solenoid Bracket	A C 0 2 0 1 0 0 0 0 0 0		53	Plain Washer		M5
15	Plain Washer		M4	54	E-ring	B P E 5 0 0 0 0 0 0 0 0	
16	Spring Washer		M4	55	Thread Trimming Shaft B	M E 0 8 1 6 B 0 * * * *	
17	Hexagon Socket Head Cap Screw	S S 6 2 0 4 1 0 0 T N 0	M4 * 10L	56	Hexagon Nut (Counterclockwise)		M6
18	Spring Washer		M3	57	M6 Joint	E F 0 8 2 7 0 1 0 0 0 0	
19	Hexagon Nut		M3	58	Hexagon Nut		M6
20	Solenoid Arm	A C 0 2 0 2 0 0 0 0 0 0		59	Thread Trimming Shaft A	M E 0 8 1 6 A 0 * * * *	
21	Arm Pin A	A C 0 2 0 3 0 0 0 0 0 0		61	Picker Stopper	A C 0 2 1 2 0 1 0 0 0 0	
22	Hollow Set Screw	S S 8 2 0 3 0 3 0 T N 0	M3 * 3L	62	Picker Bracket	A C 0 2 0 6 0 1 0 0 0 0	
23	Hexagon Socket Head Cap Screw	S S 6 2 0 4 1 2 0 C C 0	M4 * 12L	63	Pan Head Screw	S S 4 1 7 5 0 8 0 M Z 0	M2.5 * 8L
24	Connecting Arm	A C 0 5 0 3 0 0 0 0 0 0		64	Cushion	A T 0 4 0 4 0 0 0 0 0 0	
25	Arm Pin B	A C 0 5 0 2 0 0 0 0 0 0		65	Cushion Pin	A T 0 4 0 5 0 0 0 0 0 0	
26	Hexagon Socket Head Cap Screw	S S 6 2 0 4 0 8 0 T N 0	M4 * 8L	66	Sensor Bracket C	A C 0 7 0 1 0 0 0 0 0 0	
27	Connecting Pin	A C 0 2 0 5 0 0 0 0 0 0		67	Searching Block	F X 0 2 1 7 0 0 0 0 0 0	
28	Connecting Plate A	A C 0 2 0 4 0 0 0 0 0 0		68	Proximity Switch	E G 6 6 0 1 0 0 0 0 0 0	
29	Hexagon Socket Head Button Screw	S S 3 2 0 3 0 5 0 C N 0	M3 * 5L	69	Pan Head Screw	S S 4 1 0 3 0 5 0 S D 0	M3 * 5L
30	Rotary Hook Base Cover	A C 0 1 0 2 0 1 0 0 0 0		70	Hexagon Socket Head Cap Screw	S S 6 2 0 4 0 8 0 T N 0	M4 * 8L
33	Picker	A C 0 2 1 0 0 1 0 0 0 0		71	Proximity Switch Lock	E D 7 6 0 4 0 0 * * * *	
34	Picker Base	A C 0 2 0 9 0 0 0 0 0 0		72	Knife Retracting Sensor Harness	E D 7 6 0 4 0 0 * * * *	
35	Picker Holder Pin	A C 0 2 1 1 0 0 0 0 0 0		73	Movable Knife	A C 0 5 1 1 0 0 0 0 0 0	
39	Flat Fillister Head Screw	A C 0 2 0 8 0 0 0 0 0 0		74	Thread Separating Plate	A C 0 5 1 2 0 0 0 0 0 0	
40	E-ring	B P E 2 0 0 0 0 0 0 0 0		75	Countersunk Head Screw	S S 1 1 0 3 0 8 0 S N 0	M3 * 8L
43	Knife Connecting Lever	A T 0 2 0 7 0 0 0 0 0 0		76	Fixed Knife	A C 0 5 1 3 0 0 0 0 0 0	
44	Connecting Lever Pin	A T 0 2 0 6 0 0 0 0 0 0		77	Fixed Knife Guide	A C 0 5 1 4 0 0 0 0 0 0	
45	Connecting Arm B	A T 0 5 0 4 0 0 0 0 0 0		78	Under Thread Presser	A C 0 5 1 5 0 0 0 0 0 0	

Note: As for parts with marks # or *, please follow our instructions on Table of Contents, in your parts order.

From the library of: Superior Sewing Machine & Supply LLC

(9604)

)

TME-DC KNIFE DRIVE SET & PICKER SET

[illegible]

From the library of: Superior Sewing Machine & Supply LLC

(9 6 0 4)